


Cable, GPSONe, LEMO to Garmin GPS receiver

Doc. No. 15113-0001X-ASY

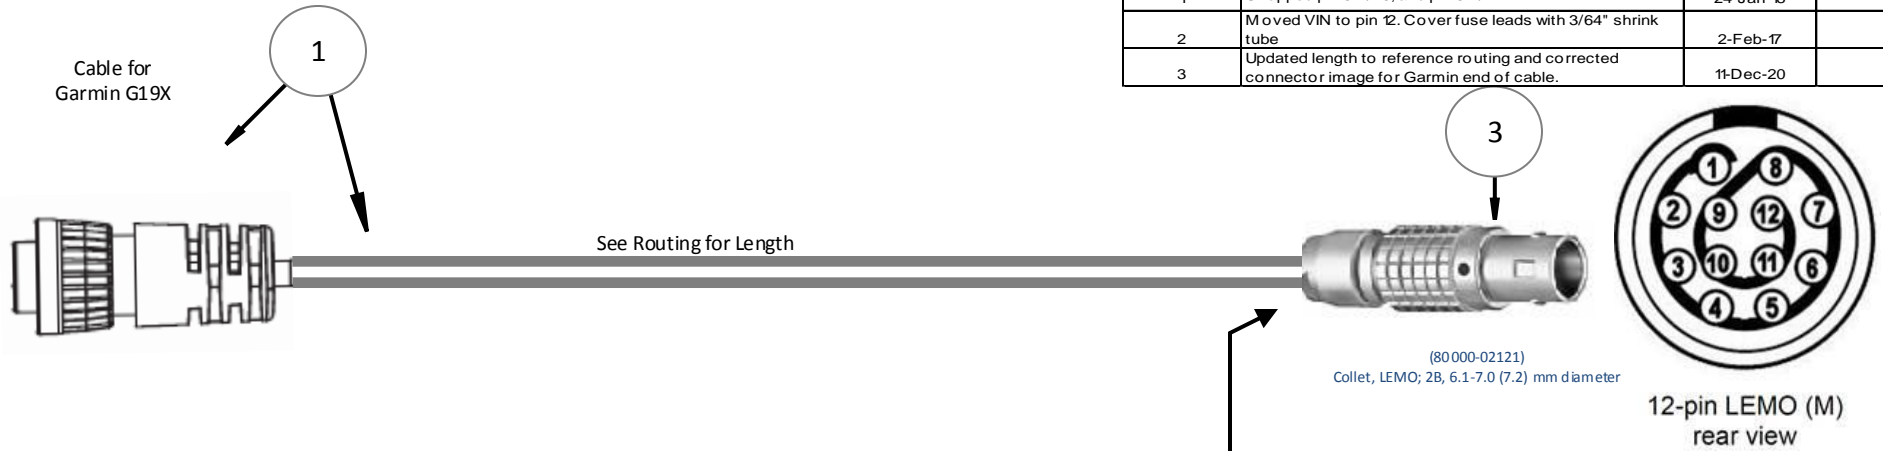

| REVISIONS | | | |
|-----------|--|-----------|------|
| REV | DESCRIPTION | DATE | APPR |
| X1 | CABLE, GPSONe, GARMIN GPS ACCESSORY | 5-Dec-17 | |
| X2 | Dc, removed fuse dwg, added fuse note, Lemo redrawn as "A" keyed | 18-Dec-17 | |
| X3 | ARM: Updated BOM to add jumpers and fuse | 18-Dec-17 | |
| X4 | ARM: Changed LEMO image to Solder-Cup View | 22-Dec-17 | |
| 0 | Added p/n, description, collet swap & lemo gender callout | 10-Jan-18 | |
| 1 | Swapped pin 5 w/ 10, and pin 6 w/ 12 | 24-Jan-18 | |
| 2 | Moved VIN to pin 12. Cover fuse leads with 3/64" shrink tube | 2-Feb-17 | |
| 3 | Updated length to reference routing and corrected connector image for Garmin end of cable. | 11-Dec-20 | |

| 0 | 1 | 2 | 3 |
|----------------------|-----------------------------------|--------------|---|
| | | | LEMO |
| | Cable for GARMIN 19X GPS RECEIVER | Function | FGA.2B.312.CLAD62 (80000-02177 male) |
| | | | Collet Swap |
| | White | RXA | 2 |
| | Gray | TXA | 3 |
| | | NC | 9 |
| 70003-00015 | Black | GND | 1 |
| | Orange | Accessory ON | 8 |
| 70003-00015 | | NC | 6 |
| | White / Orange | RXB | 7 |
| | Violet | 1PPS | 5 |
| | White / Red | TXB | 4 |
| | Red | VIN | 12 |
| | | NC | 11 |
| | | NC | 10 |
| RXE030 (30000-00535) | | | |

Note:

- ITEM 0 (Fuse, 30000-00535) is mounted inside the LEMO shell.
- Cover fuse leads with 3/64" shrink tube

Copyright © 2017-2020 Diversified Technical Systems, Inc. All rights reserved.

TITLE: CABLE, GPSONe, GARMIN ACCESSORY

| PROJECT | DOCUMENT NUMBER | REV | SHEET | SIZE |
|---------|-----------------|-----|-------|------|
| GPS | 15113-0001X-ASY | 3 | 1 | |

FILE NAME: 15113-0001X-ASY

| DATE CREATED | BY | LAST REVISED | BY | APPROVED |
|--------------|----|--------------|----|----------|
| 22-Dec-2017 | AM | 11 Dec 2020 | EK | JP |